Automatic Upper

Arm Blood

Pressure Monitor

Instruction Manual



IM-HEM-7134-E-EN-01-05/2015 3270152-8A

Introduction

Thank you for purchasing the OMRON M3 Comfort Automatic Upper Arm Blood Pressure Monitor.

The OMRON M3 Comfort is a compact, fully automatic upper arm blood pressure monitor, operating on the oscillometric principle. It measures your blood pressure and pulse rate simply and quickly. For comfortable controlled inflation without the need of pressure pre-setting or re-inflation the device uses its advanced "IntelliSense" technology.

Intended Use

This device is a digital monitor intended for use in measuring blood pressure and pulse rate in adult patient population who can understand this instruction manual with the arm circumference range printed on the arm cuff. The device detects the appearance of irregular heartbeats during measurement and gives a warning signal with the measurement result.

Please read this instruction manual thoroughly before using the device. Please keep for future reference. For specific information about your own blood pressure, CONSULT YOUR PHYSICIAN.

Important Safety Information

A Warning: Indicates a potentially hazardous situation which. if not avoided. could result in death or serious injury.

(General Usage)

- ADO NOT adjust medication based on measurement results from this blood pressure monitor. Take medication as prescribed by your physician. Only a physician is qualified to diagnose and treat High Blood Pressure.
- A Consult your physician before using the device in pregnancy including
- pre-eclampsia, or if diagnosed with arrhythmia or arteriosclerosis.
- ADo not use the device on the injured arm or the arm under medical treatment.
- A Do not apply the arm cuff on the arm while being on an intravenous drip or blood transfusion A Consult your physician before using the device on the arm with an arterio-venous
- (A-V) shunt. A Do not use the device with other medical electrical (ME) equipment
- simultaneously A Do not use the device in the area the HF surgical equipment, MRI, or CT scanner
- exists, or in the oxygen rich environment A The air tube or the AC adapter cable may cause accidental strangulation in

infants A Contained small parts that may cause a choking hazard if swallowed by infants. (AC Adapter (optional) Usage)

- A Do not use the AC adapter if the device or the power cord is damaged. Turn off the power and unplug the power cord immediately.
- APlug the AC adapter into the appropriate voltage outlet. Do not use in a multi-outlet plug.
- ANever plug in or unplug the power cord from the electric outlet with wet hands. Caution: Indicates a potentially hazardous situation which, if not avoided, may result in minor or moderate injury to the user or patient or

damage to the equipment or other property (General Usage)

- Δ Always consult your physician. Self-diagnosis of measurement results and self-treatment are dangerous.
- Δ People with severe blood flow problems, or blood disorders, should consult a physician before using the device, as the arm cuff inflation can cause bruising.
- A Remove the arm cuff if it does not start deflating during the measurement.
- Do not use this device on infants or persons who cannot express their intentions. Δ Do not use the device for any purpose other than measuring blood pressure.
- A Use only the approved arm cuff for this device. Use of other arm cuffs may result in incorrect measurement results.
- Δ Do not use a mobile phone or other devices that emit electromagnetic fields, near the device. This may result in incorrect operation of the device.

Δ Do not disassemble the monitor or arm cuff. This may cause an inaccurate

- reading. Δ Do not use in a location with moisture, or a location where water may splash on the device. This may damage the device.
- Do not use the device in a moving vehicle (car, airplane).

 Δ Do not take measurements more than necessary. It may cause bruising due to blood flow interference.

 Δ Consult your physician before using the device if you had a mastectomy. \triangle Read "If your systolic pressure is more than 210 mmHg" of this instruction manual, if your systolic pressure is known to be more than 210 mmHg. Inflating to a higher pressure than necessary may result in bruising where the cuff is

applied.

- (AC Adapter (optional) Usage)
- Fully insert the power plug into the outlet Δ When disconnecting the power plug from the outlet, do not pull the power cord.
- Be sure to pull from the power plug safely. Δ When handling the power cord, take care not to do the following:
- Do not damage. Do not break it.
- Do not tamper with it. Do not forcibly bend or pull.
 - Do not bundle during use. Do not twist.
 - Do not pinch. Do not place under heavy objects.
- \triangle Wipe the dust off from the power plug. Cuplug monitor when not in use.

Disconnect the power plug before cleaning.

⚠ Use only an OMRON AC adapter designed for this device. Use of unsupported adapters may damage and/or may be hazardous to the device.

(Battery Usage)

- Δ Do not insert the batteries with their polarities incorrectly aligned.
- Δ Use only 4 "AA" alkaline or manganese batteries with this device. Do not use other types of batteries. Do not use new and used batteries together. \triangle Remove the batteries if the device will not be used for three months or more. **General Precautions**
- Do not forcibly crease the arm cuff or the air tube excessively.
- Do not press the air tube while taking a measurement.
- To unplug the air plug, pull on the air plug at the connection with the monitor, not the tube itself.
- Do not drop the monitor or subject device to strong shocks or vibrations.
- Do not inflate the arm cuff when it is not wrapped around your arm.
- Do not use the device outside the specified environment. It may cause an inaccurate reading.
- Read and follow the "Important information regarding Electro Magnetic Compatibility (EMC)" in the "6. Specifications".
- Read and follow the "Correct Disposal of This Product" in "6. Specifications" when disposing of the device and any used accessories or optional parts.

1. Know Your Device

Contents:

Monitor, arm cuff, instruction manual, storage case, battery set, blood pressure pass

H. Blood pressure level indicator

Battery compartment

(for optional AC adapter)

Arm cuff (Arm circumference 22 - 42 cm)

Average value symbol

Movement error symbol

Irregular heartbeat symbol

AB. Pulse display/Memory number

Blood pressure level indicator (bar)

Normal Heartbeat

Irregular Heartbeat

100

88

Pulse

Blood pressure

Blood pressure

N. Date/Time display

AA. Deflation symbol

AC adapter jack


(colour)

Air jack

M. Air plua

N. Air tube

Monitor:

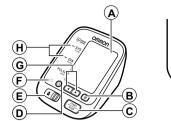


- A. Display B. Memory button
- C. START/STOP button
- D. Date/Time setting button
- E. USER ID selection switch F. Cuff wrap guide lamp
- G. Up/Down buttons

Arm cuff:





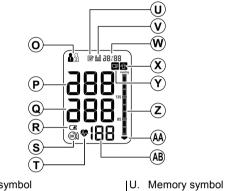

- O. USER ID symbol
- P. Systolic blood pressure Q. Diastolic blood pressure
- R. Battery symbol (low/depleted)
- Cuff wrap guide symbol
- T. Heartbeat symbol (Flashes during measurement.)

Display symbols:

- Irregular Heartbeat Symbol (🖾) When the monitor detects an irregula rhvthm two or more times during the measurement, the irregular heartbeat symbol will appear on the display with the measurement values.
- An irregular heartbeat rhythm is defined as a rhythm that is 25% less or 25% more than the average rhythm detected
- while the monitor is measuring the systolic and diastolic blood pressure.

If the irregular heartbeat symbol displays with your measurement results, we recommend you consult your physician. Follow the directions of your physician.

Movement Error Symbol (🗃)

The movement error symbol is displayed if you move your body during the measurement. Please remove the arm cuff, and wait 2 - 3 minutes. Take another measurement, remain still during measurement.

Average Value Symbol (🛗)

The average value symbol is displayed when you press and hold the memory button for more than 3 seconds. The most recent average value appears on the display screen

Cuff Wrap Guide Lamp (i)

If the cuff was wrapped too loosely, it may cause unreliable values. If the wrapping of cuff is too loose, the cuff wrap guide lamp does not light. Otherwise in lights in green. This is the function which is used as an aid in determining if the cuff is wrapped snugly enough.

Blood Pressure Level Indicator (Colour)

If your systolic or diastolic pressure is above the standard range (135 mmHg for the systolic blood pressure and/or 85 mmHg for the diastolic blood pressure), the blood pressure level indicator (colour) will light in orange when the measurement result is displayed. If they are within the standard range, no light will appear.

The JNC7* Guideline recommends the following guideline.

		General Guidelines for Blood Pressure	
		Prehypertension at Office	Hypertension at Home
	Systolic Blood Pressure	120 - 139 mmHg	135 mmHg
	Diastolic Blood Pressure	80 - 89 mmHg	85 mmHg
These are form statistical values for blood pressure.			ł.

* JNC7: The Seventh Report, 2003 Dec, of the Joint National Committee on Prevention, Detection, Evaluation, and Treatment of High Blood Pressure.

2. Preparation

- 2.1 Battery Installation
- 1. Remove the battery cover.
- 2. Insert 4 "AA" batteries as indicated in the battery compartment.
- 3. Replace the battery cover. Notes

batteries are replaced.

the first time.

Year

_20_14

1. Press the \bigcirc button.

3. Using the Device

securely

upper arm.

3.1 Applying the Arm Cuff

Do not place the arm cuff over thick clothes.

1. Insert the air plug into the air jack

2. Apply the arm cuff to your left

The bottom edge of the arm cuff

Cuff should be positioned on the

towards your hand.

3. Secure closed with the

fabric fastener.

Notes:

air tube.

for your measurements

upper arm with the air tube pointing

· When you take a measurement on the right

arm, the air tube will be at the side of your

elbow. Be careful not to rest your arm on the

should be 1 to 2 cm above the elbow.

: Forward

I : Back

Notes

2.2 Setting the Date and Time

2. Push \triangleleft or \blacktriangleright to change the year

Change Confirm

• When the depleted battery symbol (_____) appears on the display, turn the

The measurement values continue to be stored in memory even after the

▲ Disposal of used batteries should be carried out in accordance with the

Set the monitor to the correct date and time before taking a measurement for

Push () button to confirm the year and then the month flashes. Repeat the

Change Confirm

same time. Long life alkaline batteries are recommended.

national/local regulations for the disposal of batteries.

same steps to change the month, day, hour, and minute

The supplied batteries may have a shorter life.

monitor off and remove all the batteries. Replace with 4 new batteries at the

3.2 How to Sit Correctly

To take a measurement, you need to be relaxed and comfortably seated, under comfortable room temperature. Avoid bathing, drinking alcohol or caffeine, smoking, exercising or eating 30 minutes before taking a measurement.


- Sit on a chair with your legs uncrossed and your feet flat on the floor.
- · Sit upright with your back straight.
- · Sit with your back and arm being supported. • The arm cuff should be placed on your arm at
- the same level as your heart.

3.3 Taking a Measurement

- Notes • To stop a measurement, press the START/STOP button once to release the air in the arm cuff
- · Remain still while taking a measurement.

The monitor is designed to take measurements and store the measurement values in the memory for 2 people using USER ID 1 and USER ID 2.

- **1.** Select your USER ID (1 or 2).
- 2. Press the START/STOP button The arm cuff will start to inflate automatically

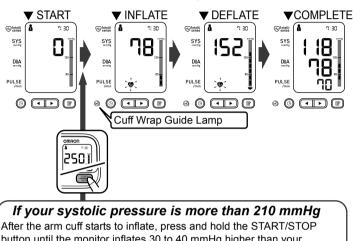

button until the monitor inflates 30 to 40 mmHg higher than your expected systolic pressure. Notes: The monitor will not inflate above 299 mmHg.

· Do not apply more pressure than necessary.

3. Remove the arm cuff.

- Press the START/STOP button to turn the monitor off. The monitor automatically stores the measurement result in its memory. It will automatically turn off after 2 minutes.
- Note: Wait 2-3 minutes before taking another measurement. Waiting between measurements allows the arteries to return to the condition prior to taking a measurement

Using the Guest Mode

- The monitor stores measurement values for 2 users in the memory. The guest mode can be used to take a single measurement for another user No measurement values are stored in the memory when the guest mode is selected.
- 1. Press and hold the START/STOP button for more than 3 seconds. The USER ID symbol and the Date/Time display will disappear.



2. Release the START/STOP button when the Date/Time display turns off The arm cuff will start to inflate autor

Always consult your physician. Self-diagnosis of measurement results and self-treatment are dangerous



The monitor automatically stores the results up to 60 sets for each user (1 and 2). It can also calculate an average value based on the last 3 measurement values taken within 10 minutes.

Notes:

- If there are only 2 measurement values in the memory for that period, the average will be based on these 2 values.
- If there is 1 measurement value in the memory for that period, this is displayed as the average • If the memory is full, the monitor will delete the oldest value.
- When viewing the measurement value taken without setting the date and time, "-:--" is displayed instead of the date and time.

To View the Measurement Values Stored in Memory


1. Select your USER ID (1 or 2).

The newest set is numbered "1".

2. Press the **₽** button.

3.4 Using the Memory Function

The Memory number appears for a second before the pulse rate is displayed.

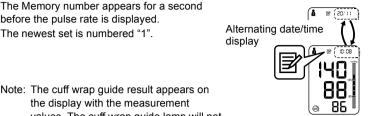

☞≣

- the display with the measurement values. The cuff wrap guide lamp will not
- liaht.
- (iii): The arm cuff was wrapped snugly enough. ()): The arm cuff was loose or not wrapped correctly.
- - To view the older values
 - ► : To view the more recent values

To View the Average Value

- 1. Select your USER ID (1 or 2).
- 2. Press and hold the 🖻 button for more than 3 seconds.


Notes:

- If the previous measurement was taken without setting the date and time, the average value is not calculated.
- If there are no measurements results stored in the memory, 8 the screen to the right is displayed.

L		J

To Delete All the Values Stored in Memory The values stored in the memory are deleted by USER ID.

- **1.** Select your USER ID (1 or 2).
- **2.** Press the Memory button, while the memory symbol (\mathbb{P}) appears.
- **3.** While holding the \square button down, press the START/STOP button for more than 3 seconds.

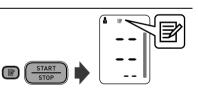


Note: You cannot partially delete the values stored in the memory. All values for the user you select will be deleted.





• The blood pressure can differ between the right arm and the left arm, and the measured blood pressure values can be different. OMRON recommends to always use the same arm for measurement. If the values between both arms differ substantially, please check with your physician which arm to use

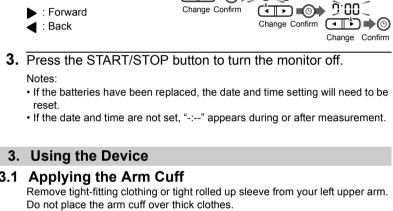



4. Error Messages and Troubleshooting 4.1 Error Messages

Error Display	Cause	Solution
\sim	Irregular heartbeats are detected.	Remove the arm cuff. Wait 2 - 3 minutes and then take another measurement. Repeat the steps in section 3.3. If this error continues to appear, contact your physician.
<i>"</i> 岱"	Movement during measurement.	Carefully read and repeat the steps in section 3.3.
\bigcirc	Arm cuff is applied too loosely.	Apply the arm cuff tighter. Refer to section 3.1.
Ĩ	The batteries are low.	Recommend to replace the batteries with new ones ahead of time. Refer to section 2.1.
Ū	The batteries are depleted.	Replace 4 batteries with new ones at once. Refer to section 2.1.
	Air plug disconnected.	Insert the plug securely. Refer to section 3.1.
E {	Arm cuff is applied too loosely.	Apply the arm cuff tighter. Refer to section 3.1.
	Air is leaking from the arm cuff.	Replace the cuff with a new one. Refer to section 5.3.
53	Movement during measurement and the arm cuff has not been inflated sufficiently.	Repeat measurement. Remain still and do not talk during measurement. Refer to section 3.3.
		If "E2" appears repeatedly, inflate the cuff manually until it is 30 to 40 mmHg above your previous measurement result. Refer to section 3.3.
63	The arm cuff was inflated exceeding the maximum allowable pressure, and then deflated automatically.	Do not touch the arm cuff and/or bend the air tube while taking a measurement. Do not inflate the arm cuff more than necessary. Refer to section 3.3.
E۲	Movement during measurement.	Repeat measurement. Remain still and do not talk during
	Movement during measurement.	measurement. Refer to section 3.3.
65	Clothing is interfering with the arm cuff.	Remove any clothing interfering with the arm cuff. Refer to section 3.1.
Er	Device error.	Contact your OMRON retail outlet or distributor.

4.2 Troubleshooting


Problem	Cause	Solution
	Arm cuff is applied too loosely.	Apply the arm cuff tighter. Refer to section 3.1.
The measurement result is extremely high (or low).	Movement or talking during measurement.	Remain still and do not talk during measurement. Refer to section 3.3.
	Clothing is interfering with the arm cuff.	Remove any clothing interfering with the arm cuff. Refer to section 3.1.
Arm cuff pressure	The air connector is not securely connected into the air jack.	Make sure that the air tube is connected securely. Refer to section 3.1.
does not rise.	Air is leaking from the arm cuff.	Replace the arm cuff with a new one. Refer to section 5.3.
Arm cuff deflates too soon.	The arm cuff is loose.	Apply the cuff correctly so that it is firmly wrapped around the arm. Refer to section 3.1.
Cannot measure or the results are too low or too high.	The arm cuff has not been inflated sufficiently.	Inflate the cuff so that it is 30 to 40 mmHg above your previous measurement result. Refer to section 3.3.
Nothing happens when you press the	The batteries are depleted.	Replace 4 batteries with new ones. Refer to section 2.1.
buttons.	The batteries have been inserted incorrectly.	Insert the batteries with the correct (+/-) polarity. Refer to section 2.1.
Other problems.	 Press the START/STOP button and repeat measurement. Replace the batteries with new ones. If the problem continues, contact your OMRON retail out or distributor. 	

5. Maintenance and Storage

5.1 Maintenance

- To protect your device from damage, please observe the following: • Store the device and the components in a clean, safe
 - location.
 - Do not use any abrasive or volatile cleaners. Do not wash the device and any components or immerse
 - them in water.

• Do not use petrol, thinners or similar solvents to clean the device.

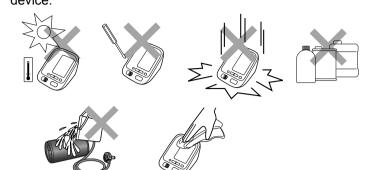


• Use a soft and dry cloth, or a soft and moistened cloth and neutral soap to clean on the monitor and the arm cuff. • Changes or modification not approved by the manufacturer will void the user warranty. Do not disassemble or attempt to repair the device or components. Consult your authorised OMRON retail outlet or distributor.

Calibration and Service

• The accuracy of this blood pressure monitor has been carefully tested and is designed for a long service life. • It is generally recommended to have the device inspected every 2 years to ensure correct functioning and accuracy. Please consult your authorised OMRON retail outlet or distributor.

5.2 Storage

- Keep the device in its storage case when not in use. **1.** Unplug the air plug from the air jack.
- **2.** Gently fold the air tube into the arm cuff.

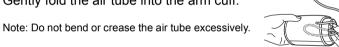

- **3.** Place the monitor and the arm cuff in the storage case.
- Do not store the device in the following situations: If the device is wet.
- Locations exposed to extreme temperatures, humidity, direct sunlight, dust or corrosive vapours
- such as bleach Locations exposed to vibrations, shocks or where
- it will be at an angle

5.3 Optional Medical Accessories (within the scope of EC Medical Device Directive 93/42/EEC)



HEM-FL31




AC ADAPTER-UK (60240HW5SW) (60240H7000SW)

AC adapter

Using the Optional AC Adapter

- **1.** Insert the AC adapter plug into the AC adapter jack on the rear side of the monitor.
- **2.** Plug the AC adapter into an electrical outlet.

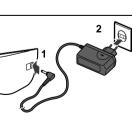

To disconnect the AC adapter, unplug the AC adapter from the electrical outlet first and then remove the AC adapter plug from the monitor.

6. Specifications

Product category Electronic Sphygmomanometers

Product category	Electronic Sphygmomanometers
Product description	Automatic Upper Arm Blood Pressu
Model (code)	M3 Comfort (HEM-7134-E)
Display	LCD Digital Display
Measurement method	Oscillometric method
Measurement range	Pressure: 0 to 299 mmHg Pulse: 40 to 180 beats/min.
Accuracy	Pressure: ±3 mmHg Pulse: ±5% of display reading
Inflation	Fuzzy-logic controlled by electric pu
Deflation	Automatic pressure release valve
Memory	60 measurements with date and tim
Rating	DC6V 4W
Power source	4 "AA" batteries 1.5V or optional AC (AC ADAPTER-S, INPUT AC100-2 (AC ADAPTER-UK, INPUT AC100-2
Battery life	Approx. 1000 measurements (using
Applied part	Type BF
Protection against electric shock	Internally powered ME equipment (batteries)
	= Class II ME equipment (Opti
Operating temperature / humidity / air pressure	+10 to +40°C / 30 to 85% RH / 700
Storage temperature / humidity / air pressure	-20 to +60°C / 10 to 95% RH / 700
IP classification	IP 20
Weight	Monitor: Approx. 300 g without batt Arm cuff: Approx. 163 g
Outer dimensions	Monitor: Approx. 107 (w) mm x 79 (Arm cuff: Approx. 145 mm x 532 m
Cuff circumference	22 to 42 cm
Cuff / Tube material	Nylon, polyester, polyvinyl chloride
Package contents	Monitor, arm cuff, instruction manua battery set, blood pressure pass
Notes:	
 These specific 	ations are subject to change without

- In the clinical validation study, the 5th phase was used on 85 subjects for determination of diastolic blood pressure.
- This device is clinically investigated according to the requirements of ISO 81060-2:2013.
- This device has not been validated for use on pregnant patients. • IP classification is degrees of protection provided by enclosures in accordance with IEC 60529.

C€0197

- This device fulfils the provisions of EC directive 93/42/EEC (Medical Device Directive)
- This blood pressure monitor is designed according to the European Standard EN1060, Non-invasive sphygmomanometers Part 1: General Requirements and Part 3: Supplementary requirements for electromechanical blood pressure measuring systems.
- This OMRON product is produced under the strict quality system of OMRON HEALTHCARE Co., Ltd., Japan. The Core component for OMRON blood pressure monitors, which is the Pressure Sensor, is produced in Japan

Important information regarding Electro Magnetic Compatibility (EMC) With the increased number of electronic devices such as PC's and mobile (cellular) telephones, medical devices in use may be susceptible to electromagnetic interference from other devices. Electromagnetic interference may result in incorrect operation of the medical device and create a potentially unsafe situation. Medical devices should also not interfere with other devices.

In order to regulate the requirements for EMC (Electro Magnetic Compatibility) with the aim to prevent unsafe product situations, the EN60601-1-2:2007 standard has been implemented. This standard defines the levels of immunity to electromagnetic interferences as well as maximum levels of electromagnetic emissions for medical devices.

This medical device manufactured by OMRON HEALTHCARE conforms to this EN60601-1-2:2007 standard for both immunity and emissions. Nevertheless, special precautions need to be observed:

 Do not use mobile (cellular) telephones and other devices, which generate strong electrical or electromagnetic fields near the medical device. This may result in incorrect operation of the device and create a potentially unsafe situation. Recommendation is to keep a minimum distance of 7 m. Verify correct operation of the device in case the distance is shorter.

Further documentation in accordance with EN60601-1-2:2007 is available at OMRON HEALTHCARE EUROPE at the address mentioned in this instruction

manual. Documentation is also available at www.omron-healthcare.com.

Correct Disposal of This Product (Waste Electrical & Electronic Equipment)

This marking shown on the product or its literature, indicates that it should not be disposed of, with other household wastes at the end of its working life. To prevent possible harm to the environment or human health from uncontrolled waste disposal, please separate this product from other types of wastes and recycle it responsibly to promote the sustainable reuse of material resources

Household users should contact either the retailer where they purchased this product, or their local government office, for details of where and how they can return this item for environmentally safe recycling.

Business users should contact their supplier and check the terms and conditions of the purchase contract. This product should not be mixed with other commercial wastes for disposal.

essure Monitor

ic pump

time for each user (1 and 2)

al AC adapter 00-240V 50/60Hz 0.12A) 100-240V 50/60Hz 15VA) using new alkaline batteries)

ent (When using only the

Optional AC adapter) 700 to 1060 hPa

700 to 1060 hPa

batteries

79 (h) mm x 141 (l) mm 2 mm

anual, storage case

nout notice.



7. Warranty

Thank you for buying an OMRON product. This product is constructed of high quality materials and great care has been taken in its manufacturing. It is designed to give you every satisfaction, provided that it is properly operated and maintained as described in the instruction manual. This product is guaranteed by OMRON for a period of 3 years after the date of purchase. The proper construction, workmanship and materials of this product is guaranteed by OMRON. During this period of guarantee OMRON will, without charge for labour or parts, repair or replace the defect product or any defective

The guarantee does not cover any of the following:

a. Transport costs and risks of transport. b. Costs for repairs and / or defects resulting from repairs done by unauthorised persons.

c. Periodic check-ups and maintenance.

d. Failure or wear of optional parts or other attachments other than the main device itself, unless explicitly guaranteed above.

e. Costs arising due to non-acceptance of a claim (those will be charged for). f. Damages of any kind including personal caused accidentally or from misuse.

g. Calibration service is not included within the guarantee.

h. Optional parts have a one (1) year warranty from date of purchase. Optional parts include, but are not limited to the following items: Cuff and Cuff Tube, AC Adapter Should guarantee service be required please apply to the dealer whom the product was purchased from or an authorised OMRON distributor. For the address refer to the product packaging / literature or to your specialised retailer. If you have difficulties in finding OMRON customer services, contact us for information.

www.omron-healthcare.com

Repair or replacement under the guarantee does not give rise to any extension or renewal of the guarantee period. The guarantee will be granted only if the complete product is returned together with

the original invoice / cash ticket issued to the consumer by the retailer.

8. Some Useful Information about Blood Pressure What is Blood Pressure?

Blood pressure is a measure of the force of blood flowing against the walls of the arteries. Arterial blood pressure is constantly changing during the course of the heart's cycle.

The highest pressure in the cycle is called the Systolic Blood Pressure; the lowest is the Diastolic Blood Pressure, Both pressures, the Systolic and Diastolic, are necessary to enable a physician to evaluate the status of a patient's blood pressure.

What is Arrhythmia?

Arrhythmia is a condition where the heartbeat rhythm is abnormal due to flaws in the bio-electrical system that drives the heartbeat. Typical symptoms are skipped heartbeats, premature contraction, an abnormally rapid (tachycardia) or slow (bradycardia) pulse.

Why is it a Good Thing to measure Blood Pressure at Home?

Many factors such as physical activity, anxiety, or the time of day, can influence your blood pressure. A single measurement may not be sufficient for an accurate diagnosis. Thus it is best to try and measure your blood pressure at the same time each day, to get an accurate indication of any changes in blood pressure. Blood pressure is typically

	200		Upper curve: systolic b Lower curve: diastolic b	
вНи	150 -		\wedge	_ Λ
m	100 -	Lin		~~
	50 -	6 12	18	24
			Time of day	
		Example: fluctuation with	in a day (male, 35 years ol	D)


low in the morning and increases from afternoon to evening. It is lower in the summer and higher in the winter.

How is Hypertension related to Stroke?

Hypertension (high blood pressure) is the key risk factor for Stroke. It is estimated that amongst hypertensive patients, effective treatment would prevent 1 in 4 haemorrhagic strokes (bleeding around the brain). Hypertension guidelines have endorsed the use of Home Blood Pressure Monitoring in addition to the measurements in physicians' offices to help manage hypertension effectively.

References to above medical claims are available upon request.

53, Kunotsubo, Terado-cho, Muko, KYOTO, 617-0002 JAPAN Sentative OMRON HEALTHCARE EUROPE B.V. Scorpius 33, 2132 LR Hoofddorp, THE NETHERLANDS www.omron-healthcare.com OMRON HEALTHCARE MANUFACTURING VIETNAM CO., LTD. No.28 VSIP II, Street 2, Vietnam-Singapore Industrial Park II, Binh Duong Industry-Services-Urban Complex, Hoa Phu Ward, Thu Dau Mot City, Binh Duong Province, Vietnam		
Scorpius 33, 2132 LR Hoofddorp, THE NETHERLANDS www.omron-healthcare.com On facility OMRON HEALTHCARE MANUFACTURING VIETNAM CO., LTD. No.28 VSIP II, Street 2, Vietnam-Singapore Industrial Park II, Binh Duong Industry-Services-Urban Complex, Hoa Phu Ward, Thu Dau Mot City, Binh Duong Province, Vietnam ies OMRON HEALTHCARE UK LTD. Opal Drive, Fox Milne, Milton Keynes, MK15 0DG, UK www.omron-healthcare.com OMRON MEDIZINTECHNIK HANDELSGESELLSCHAFT mbH Gottlieb-Daimler-Strasse 10, 68165 Mannheim, GERMANY www.omron-healthcare.com OMRON SANTÉ FRANCE SAS 14, rue de Lisbonne, 93561 Rosny-sous-Bois Cedex, FRANCE	turer	53, Kunotsubo, Terado-cho, Muko, KYOTO,
No.28 VSIP II, Street 2, Vietnam-Singapore Industrial Park II, Binh Duong Industry-Services-Urban Complex, Hoa Phu Ward, Thu Dau Mot City, Binh Duong Province, Vietnam ies OMRON HEALTHCARE UK LTD. Opal Drive, Fox Milne, Milton Keynes, MK15 0DG, UK www.omron-healthcare.com OMRON MEDIZINTECHNIK HANDELSGESELLSCHAFT mbH Gottlieb-Daimler-Strasse 10, 68165 Mannheim, GERMANY www.omron-healthcare.com OMRON SANTÉ FRANCE SAS 14, rue de Lisbonne, 93561 Rosny-sous-Bois Cedex, FRANCE	sentative REP	Scorpius 33, 2132 LR Hoofddorp, THE NETHERLANDS
Opal Drive, Fox Milne, Milton Keynes, MK15 0DG, UK www.omron-healthcare.com OMRON MEDIZINTECHNIK HANDELSGESELLSCHAFT mbH Gottlieb-Daimler-Strasse 10, 68165 Mannheim, GERMANY www.omron-healthcare.com OMRON SANTÉ FRANCE SAS 14, rue de Lisbonne, 93561 Rosny-sous-Bois Cedex, FRANCE	on facility	No.28 VSIP II, Street 2, Vietnam-Singapore Industrial Park II, Binh Duong Industry-Services-Urban Complex, Hoa Phu Ward, Thu Dau Mot City,
Gottlieb-Daimler-Strasse 10, 68165 Mannheim, GERMANY www.omron-healthcare.com OMRON SANTÉ FRANCE SAS 14, rue de Lisbonne, 93561 Rosny-sous-Bois Cedex, FRANCE	ries	Opal Drive, Fox Milne, Milton Keynes, MK15 0DG, UK
14, rue de Lisbonne, 93561 Rosny-sous-Bois Cedex, FRANCE		Gottlieb-Daimler-Strasse 10, 68165 Mannheim, GERMANY
		14, rue de Lisbonne, 93561 Rosny-sous-Bois Cedex, FRANCE

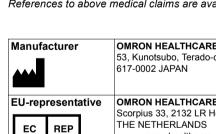

Subsidiar

Productio

Made in Vietnam